

Service Bulletin

Date: 1st March 2018

Affects: All QC-760X change machines using a Topway LM32019EFW blue graphical display.

Severity: Medium


Description: Topway LM32019EFW **blue graphical display** is now End of Life.

Action to be taken:

Topway **LM32019ECW-1**, Anztec pn. **50-000301**, will become the default display. This display is black text on a white background.

As the backlight current requirements are different for the new display the current limiting resistors on the EVO 700-10X board must be changed to accommodate this.

Change resistors R46 and R47 on the 700-10X board from 15 Ohms to 20 Ohms 0.5W

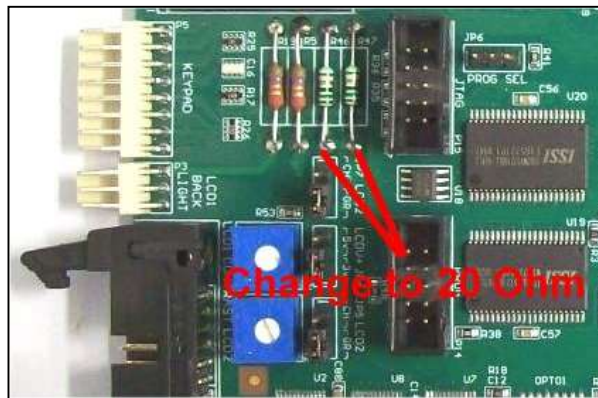

LM32019ECW-1 also has no contrast adjustment so potentiometer VR2 will be rendered obsolete.

Failure to change the resistor values will allow too much current to flow into the backlight and shorten its lifespan possibly permanently damaging or destroying it completely in a short space of time.